Shielded Cable Termination
Flexible Cable - Straight Crimp Type
End Launch

INCHES (MILLIMETERS)
CUSTOMER DRAWINGS AVAILABLE UPON REQUEST

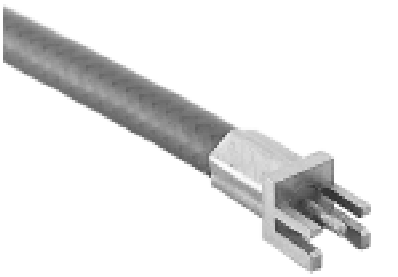

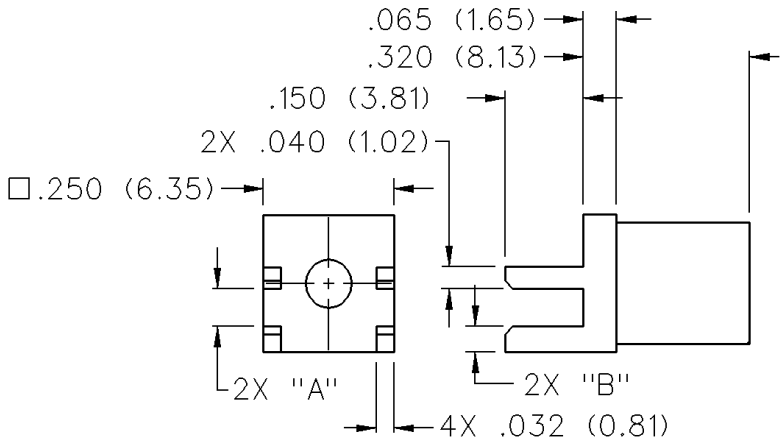

CABLE TYPE	BOARD THICKNESS	GOLD PLATED	"A"	"B"
RG178/U, 196	0.047 (1.19)	142-0002-811	0.053 (1.35)	0.065 (1.65)

CABLE GROUP	PART NUMBER	CRIMP HEX
RG-178/u, 196	142-0002-811	.105 (2.67)

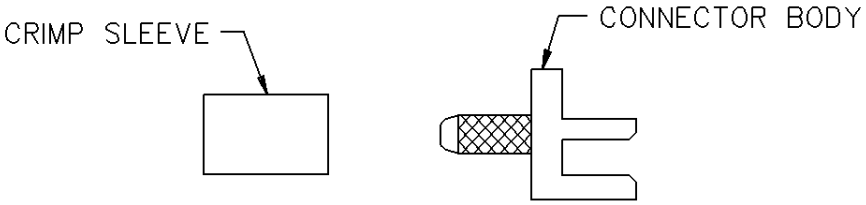

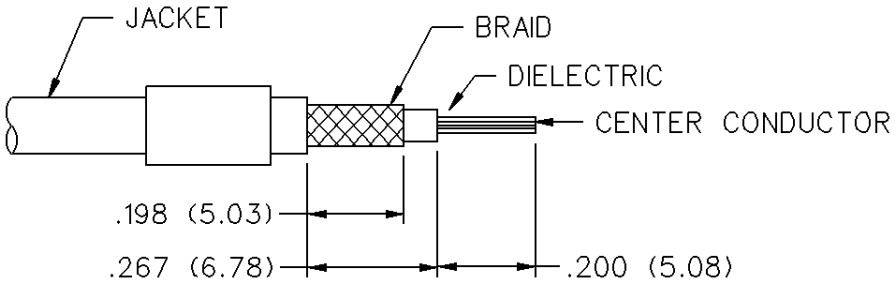

1. Identify connector parts. (2 piece parts)
2. Strip cable to dimensions shown. Do not nick braid or center conductor. A wire stripper of correct size is recommended for this step. Twist stranded center conductor into tight bundle and tin. Slide crimp sleeve onto cable as shown.
3. Flare braid and slide cable into body making certain that the cable insulation is flush with bottom of connector body.
4. Arrange braid uniformly around crimp stem. Slide crimp sleeve over braid and crimp securely using recommended crimp tool.

Cinch Connectivity Solutions
299 Johnson Avenue SW, Waseca, MN 56093 USA • 800.247.8256 • +1 507 833 8822 • cinchconnectivity.com